

ASAP

# Work Order ID 68279

Monday, April 11, 2011 12:37:18 PM



Item ID:	D3391-023	Accept		Setup	Start	
Revision ID:					Stop	
Item Name:	Mid Tube Assembly					
Start Date:	4/11/2011	Start Qty:	1.00			
Required Date:	4/15/2011	Req'd Qty:	1.00			
Reference:						

Approvals:	Process Plan:	<i>M</i>	Date:	<i>11-04-11</i>	Tooling:		Date:		Run	Start	
	QC:		Date:		SPC (Y/N):		Date:			Stop	

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3391	Rev H								

100

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Cut tube to finish length as per Dwg D3391

2-Identify as D3391-023

3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

N/A

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

N/A

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391

6-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

7-Deburr

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J" do not open wearplate holes of section "J"

N/A

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

*Handwritten notes and signatures:*  
 A large handwritten 'U' and a signature 'DP' are present.  
 The date '11-4-13' is written in the bottom right.  
 The text '50/104-728 and only' is written in the bottom right.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 68279**

Monday, April 11, 2011 12:37:18 PM



Page 2

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 4/11/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 4/15/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Stop



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

11-Open .375" holes to .438" \*\*\*do not open fwd saddle holes\*\*\*

N/A

DP

11-4-13

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allignment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

N/A

15- Locating from two fwd wearplate holes drill remaining 6 wearplate holes in D3391-021 using DT8937

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open 12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

DP

11-4-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 68279**

Page 3

Monday, April 11, 2011 12:37:18 PM

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 4/11/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 4/15/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Stop



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

110

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

11 04 14 ①

120

Chemical Conversion Coat per QSI005 4.1

0.00



HandFinish

Memo

0.00

Hand Finishing

1 BE 11/04/15

130

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

1 0 BE 11/04/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 68279**

Monday, April 11, 2011 12:37:18 PM



Page 4

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 4/11/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 4/15/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Open float bag holes as per dwg  
2-C'sink float bag holes as per dwg  
3- Prepare tube for welding  
4-Bond web in place as per Dwg D3391 & QSI 015.  
Adhere for 12 hours)  
A/R Sikaflex exp: 12/10/15  
batch# m116943

1 0 3E11/04/15

150

0.00



QC5- Inspect part completeness to step on W/O

QC

Memo

0.00

Quality Control

DP 11-4-18

160

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Weld crossbolt spacer as per dwg D3391 & QSI 004  
2-grind weld flush

1 0 3E11/04/18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



\_\_\_\_\_

Page 5

**Accept**

\_\_\_\_\_

**Setup Start**

**Abstract**

**Stop**

\_\_\_\_\_

1. The first step in the process is to identify the problem or issue that needs to be addressed. This involves gathering information and understanding the context of the problem.

**Cust Item ID:**[illegible]

**Customer:**

**Reference:**

Run Start

[illegible]

**Approvals:** \_\_\_\_\_ **Process Plan:** \_\_\_\_\_ **Date:** \_\_\_\_\_ **Tooling:** \_\_\_\_\_ **Date:** \_\_\_\_\_

**Stop**



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

**Insp.  
Stamp**

0.00

[illegible]

QC

## Memo

0.00

### Quality Control

0.00



QC

## Memo

0.00

## Quality Control

0.00

[illegible]

**HandFinish**

## Memo

0.00

## Hand Finishing

— AND REALODINE AS PER PAR09-043

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 68279**

Monday, April 11, 2011 12:37:18 PM



Page 6

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 4/11/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 4/15/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: \_\_\_\_\_

Date: \_\_\_\_\_

Tooling: \_\_\_\_\_

Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_

Date: \_\_\_\_\_

SPC (Y/N): \_\_\_\_\_

Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

190



Powdercoat

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

M116964.

Powder Coating

Memo

0.00

START TIME: 2:00  
OVEN TEMPERATURE: 300°  
FINISH TIME: 2:30

1 BR 11-4-20

200



QC

QC3- Inspect Part Finish

0.00

Memo

0.00

Quality Control

1 of 11 4/11/20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 68279**

Monday, April 11, 2011 12:37:18 PM



Page 7

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 4/11/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 4/15/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: \_\_\_\_\_

Date: \_\_\_\_\_

Tooling: \_\_\_\_\_

Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_

Date: \_\_\_\_\_

SPC (Y/N): \_\_\_\_\_

Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

210



Skidtubes

Skidtubes

0.00

0.00

Memo

1- insert D3391-021 into D3391-23

2- insert T-pins into first and third fwd saddle holes

3- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364

4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos

5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". Remove DT9415

6- deburr, re-alodine and blow out chips

7- press fit D3591-1 spacers using DT9416 starting from 0.500" side

220



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

0.00

Memo

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 68279**

Monday, April 11, 2011 12:37:18 PM



Page 8

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 4/11/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 4/15/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Stop



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

230

0.00



HandFinishing

HandFinish

Memo

0.00

Hand Finishing

Install Inserts as per Dwg

1 0 11/10/12

PTOZ)

240

0.00



QC5- Inspect part completeness to step on W/O

QC

Memo

0.00

Quality Control

8 work/21

250

0.00



Identify as per dwg &amp; Stock Location: \_\_\_\_\_

Packaging

Memo

0.00

Packaging

11/4/12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
11/04/20	230	Assemble with D3564-5 / B66551 (wear plate) D3566-5 / B66552 (GASKET)	JL	11/04/20	X1 X1		
11/04/20	230	Assemble with NAS1149C0332R / M117291 (washers) AN3C-4A / M116924 (bolts)	JL	11/04/20	X12 X12		

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



**Work Order ID 68279**

Monday, April 11, 2011 12:37:18 PM



Page 9

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 4/11/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 4/15/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals:

Process Plan: \_\_\_\_\_

Date: \_\_\_\_\_

Tooling: \_\_\_\_\_

Date: \_\_\_\_\_

Stop



QC: \_\_\_\_\_

Date: \_\_\_\_\_

SPC (Y/N): \_\_\_\_\_

Date: \_\_\_\_\_

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

260

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

ck 4/04/21

mf

11-04-21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Page 1

Monday, April 11, 2011 12:37:24 PM

Work Order ID: 68279

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly






Start Date: 4/11/2011

Required Date: 4/15/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A 05.10.20 New Issue KJ/EC  
 IPP B 06.02.10 ECN773 dwg rev.D EC  
 IPP C 07.03.20 rev F dwg EC  
 IPP D 07.03.28 re-format EC  
 IPP E 07.10.31 ecn 1053P EC  
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC  
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC  
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC  
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP  
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

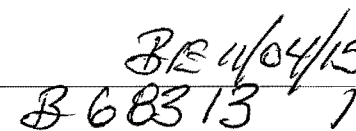Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-100  Skidtube Extrusion		Manufactured	No			100	Each	104.0000	1	1			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				HALL		104							
				37065		22							
				50251		82							
D3391-021  Fwd Tube Assembly		Manufactured	No			100	Each	0.0000	1	1			
D3389-1  Web		Manufactured	No			140	Each	1.0000	1	1			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				ST055		1							
				65989		1							

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Monday, April 11, 2011 12:37:24 PM

Page 2

Work Order ID: 68279

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 4/11/2011

Required Date: 4/15/2011

Start Qty: 1.00

Required Qty: 1.00

D3681-1  
Spacer  
Manufactured No

160 Each

29.0000

5

5

*BE d/o 4/18*

Location

Loc Qty

Loc Code

LG001

29

65990

29

*5*

D3591-1  
Bushing  
Manufactured No

210 Each

59.0000

2

2

Location

Loc Qty

Loc Code

ST068

59

57350

22

66147

37

ALS4-1032-130  
Insert  
Purchased No

230 Each

2,000.000

20

20

*ll 11/04/20*

Location

Loc Qty

Loc Code

ST281

2000

117331

2000

*1116800*

*x20*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT

WITHOUT NOTICE  
WORK ORDER  
NO. 48279  
P/H-04-4

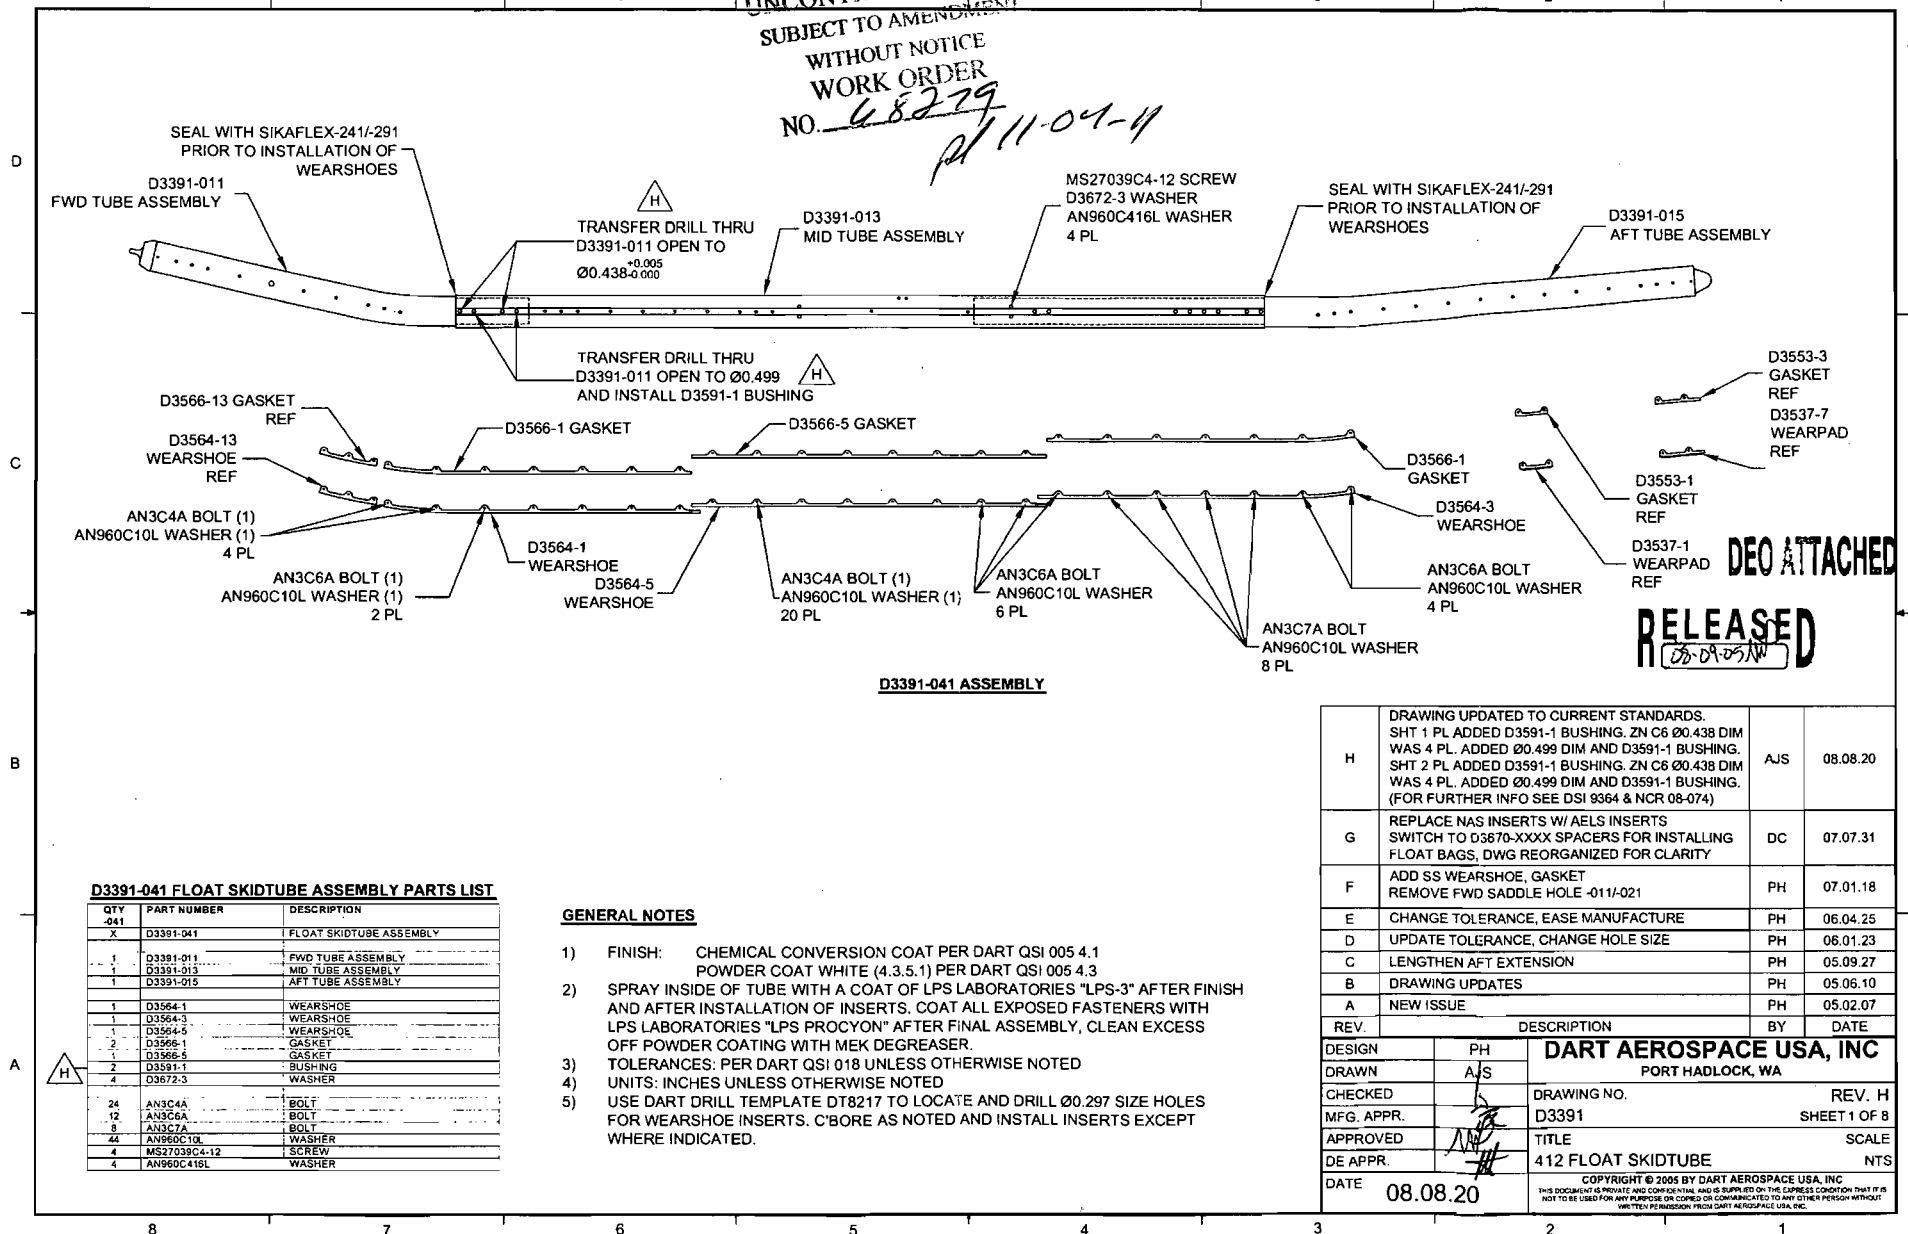

**D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
1	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

**GENERAL NOTES**

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH  
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH  
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS  
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL  $\varnothing 0.297$  SIZE HOLES  
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT  
WHERE INDICATED.

H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 $\varnothing 0.438$ DIM WAS 4 PL. ADDED $\varnothing 0.499$ DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 $\varnothing 0.438$ DIM WAS 4 PL. ADDED $\varnothing 0.499$ DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



u1068279

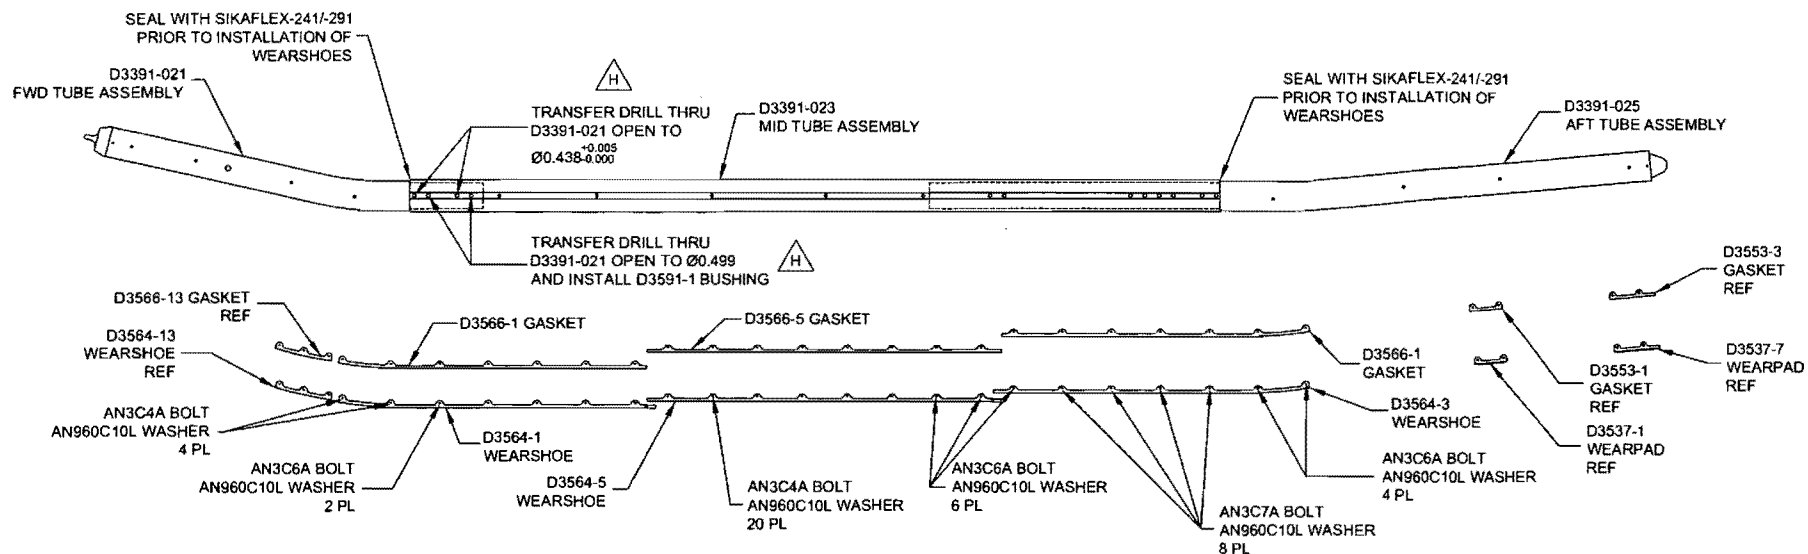

**D3391-043 ASSEMBLY**

**D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-022	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3553-1	BUSHING
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER

**GENERAL NOTES**

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. CBORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DEO ATTACHED

RELEASED  
08.09.20

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AUS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>           COPYRIGHT © 2005 BY DART AEROSPACE USA, INC            THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS            NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT            WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.         </small>	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


**NOTE:** Date & initial all entries

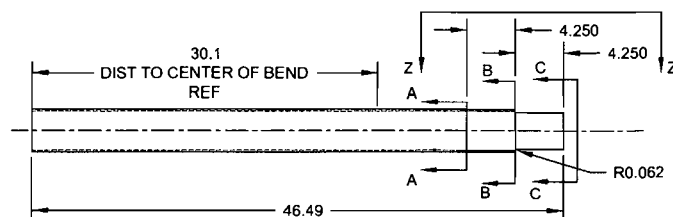


**D3391-1 CUTTING DETAIL**  
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

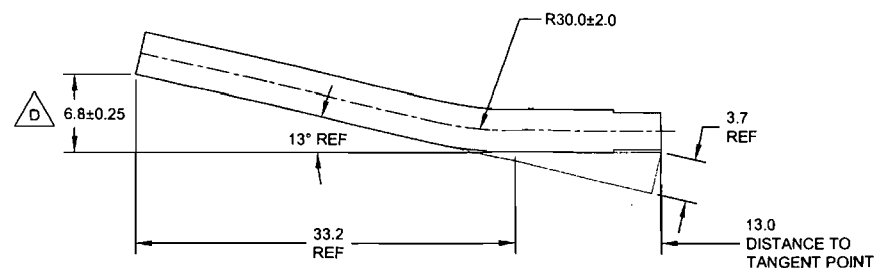


**D3391-011/-021 BENDING DETAIL**  
(MAKE FROM D3391-1)

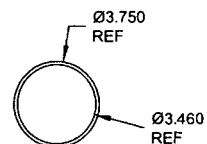


**SECTION A-A**  
SCALE 2X

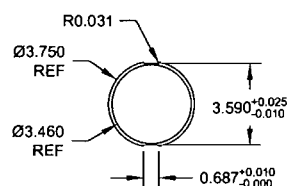

**SECTION B-B**  
SCALE 2X

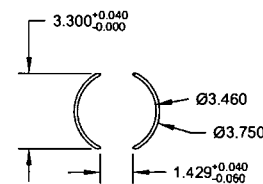

**SECTION C-C**  
SCALE 2X

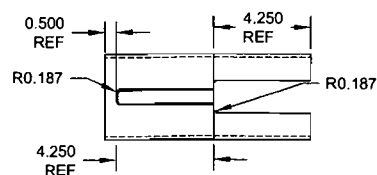

**VIEW Z-Z**  
SCALE 2X

DEO ATTACHED  
**RELEASED**  
08-05-11

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS REPAIRED AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


**NOTE:** Date & initial all entries

466827

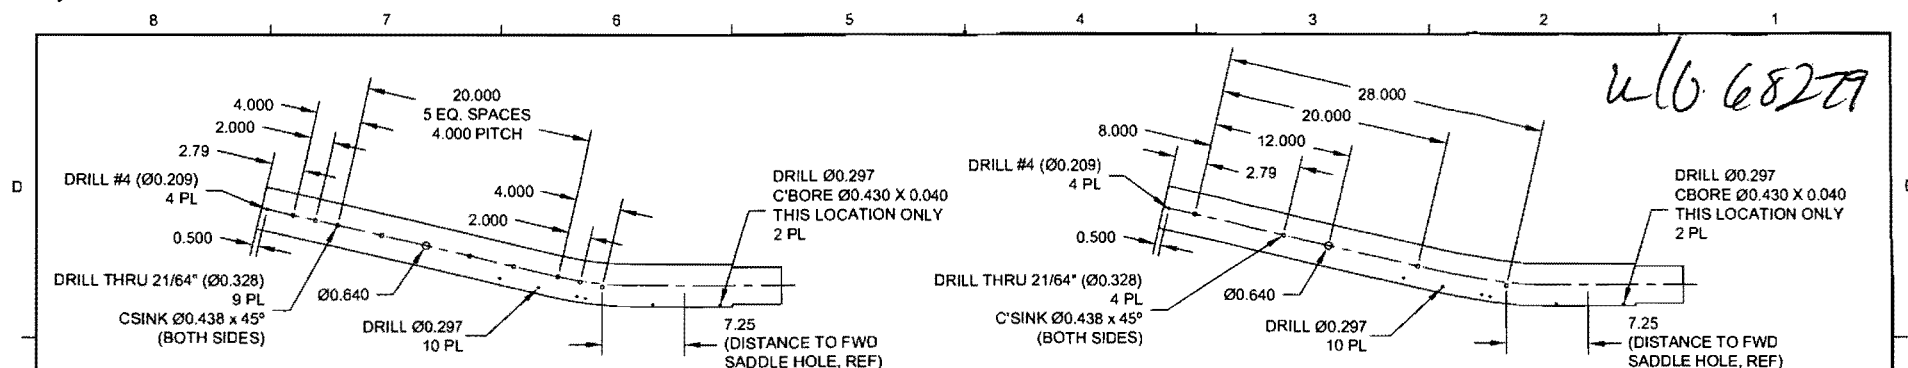

**D3391-011 DRILLING DETAIL**

**D3391-021 DRILLING DETAIL**

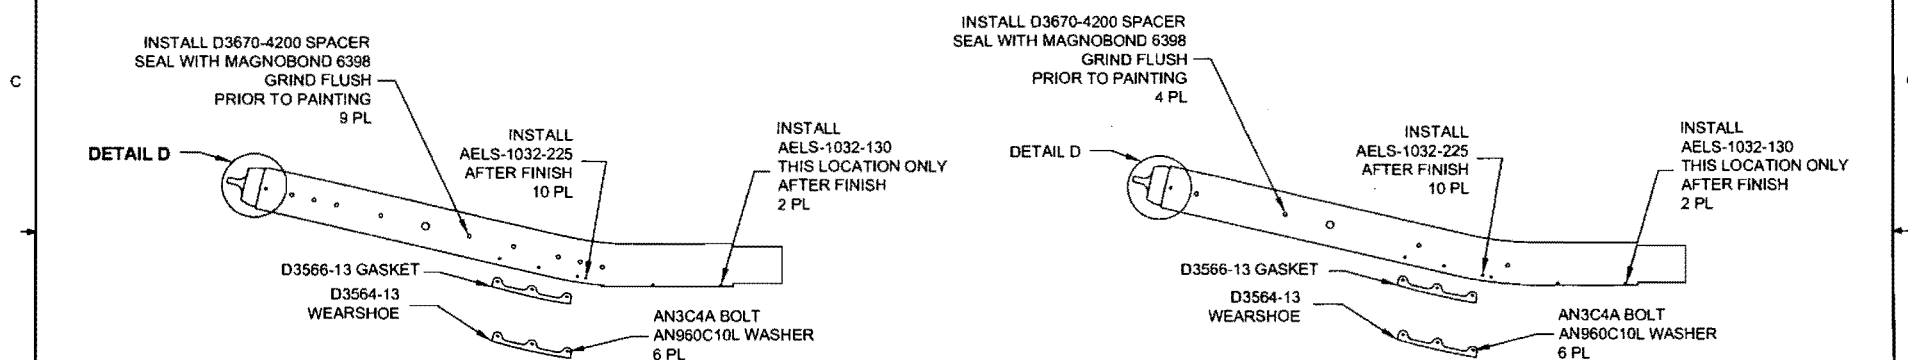


**D3391-011 ASSEMBLY DETAIL**

**D3391-021 ASSEMBLY DETAIL**




**D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST**

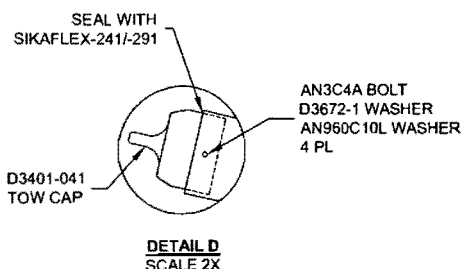QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
1	1	D3564-13	WEARSHOE
1	1	D3566-13	GASKET
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
2	2	AELS-1032-130	INSERT
10	10	AELS-1032-225	INSERT



**DETAIL D  
SCALE 2X**

DEO ATTACHED  
RELEASED  
08-09-05-10

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

W/O 68279

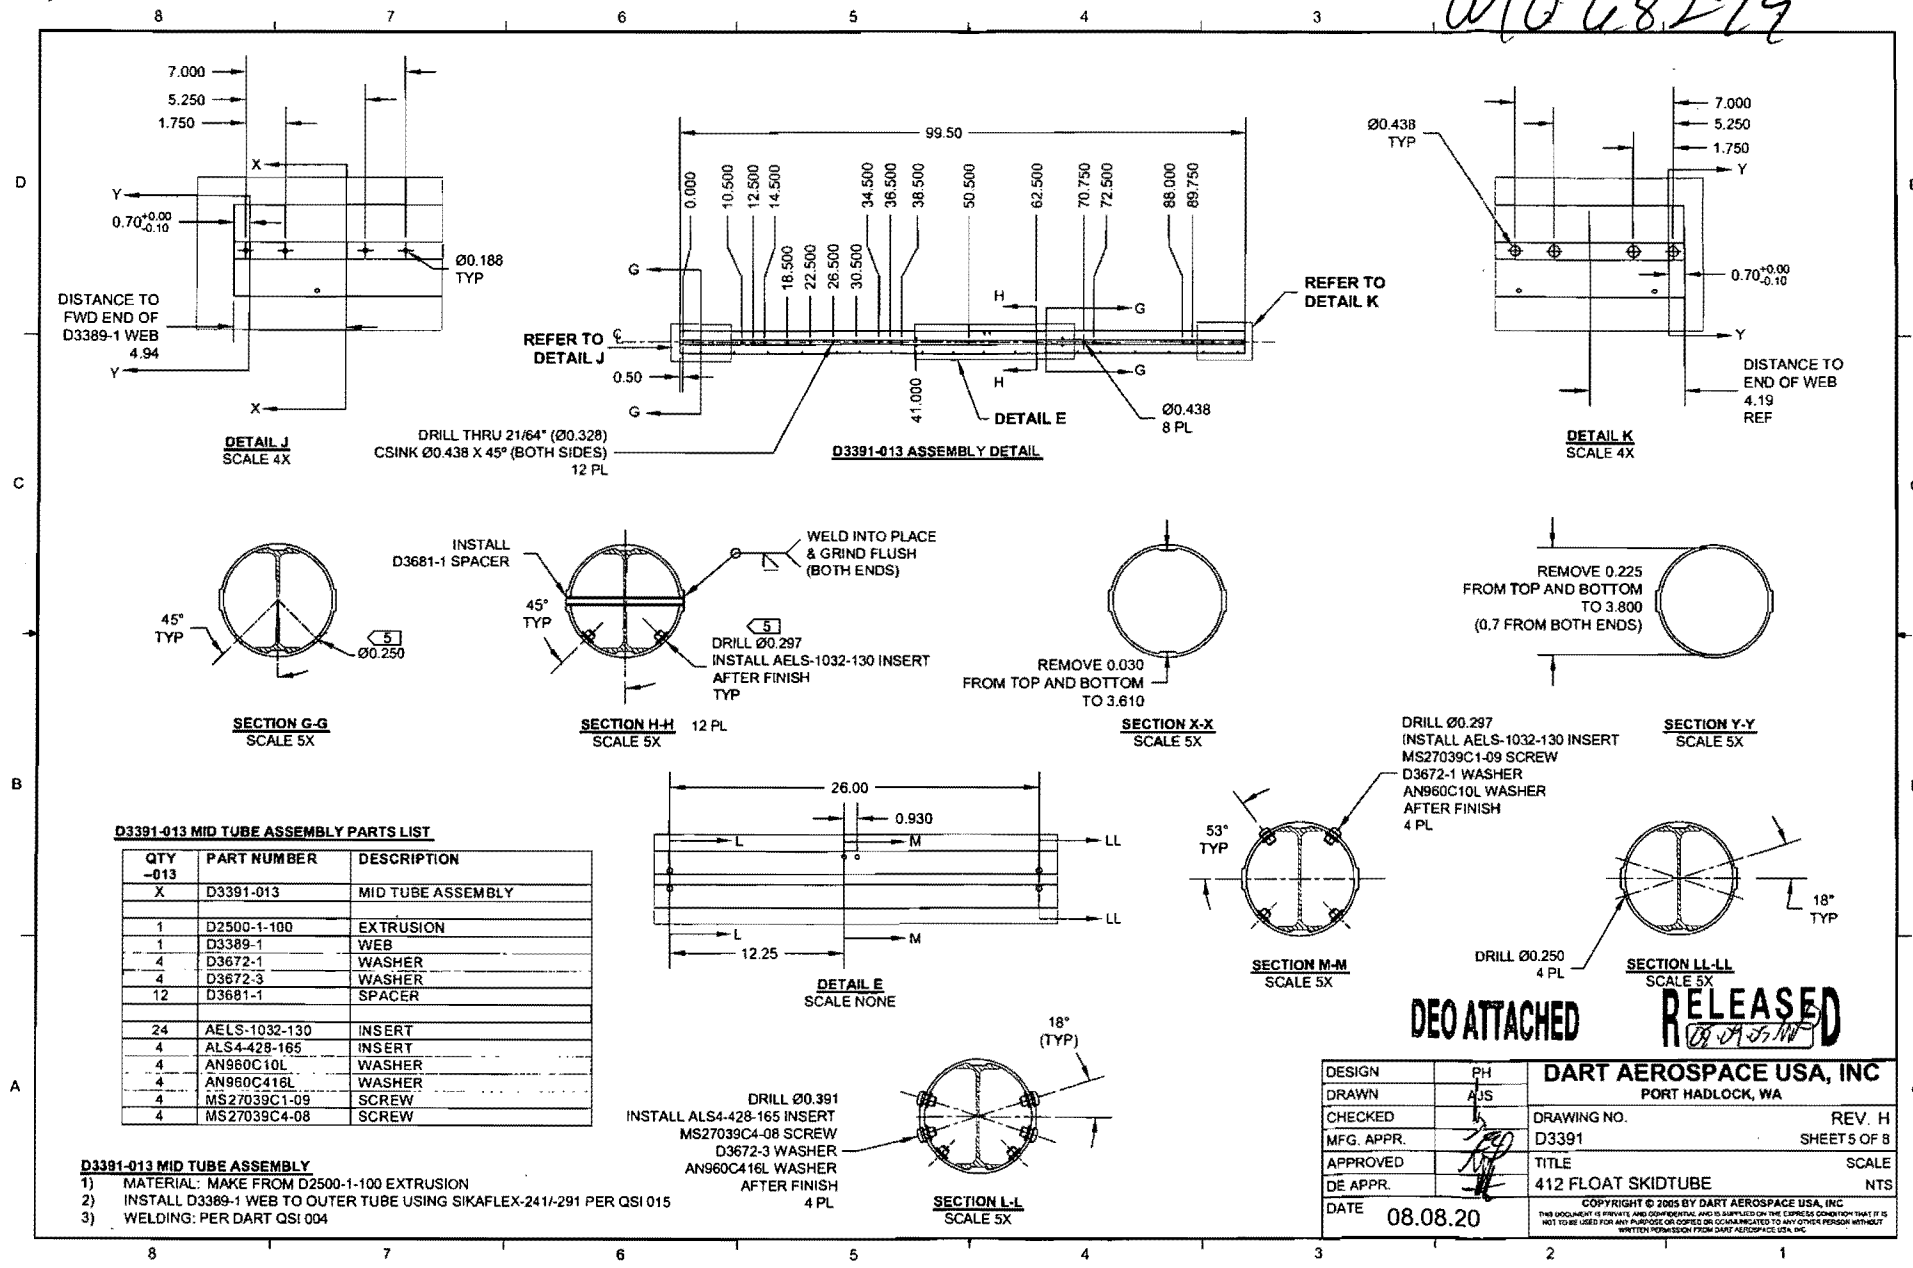

DEO ATTACHED RELEASED

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



ULO 48229

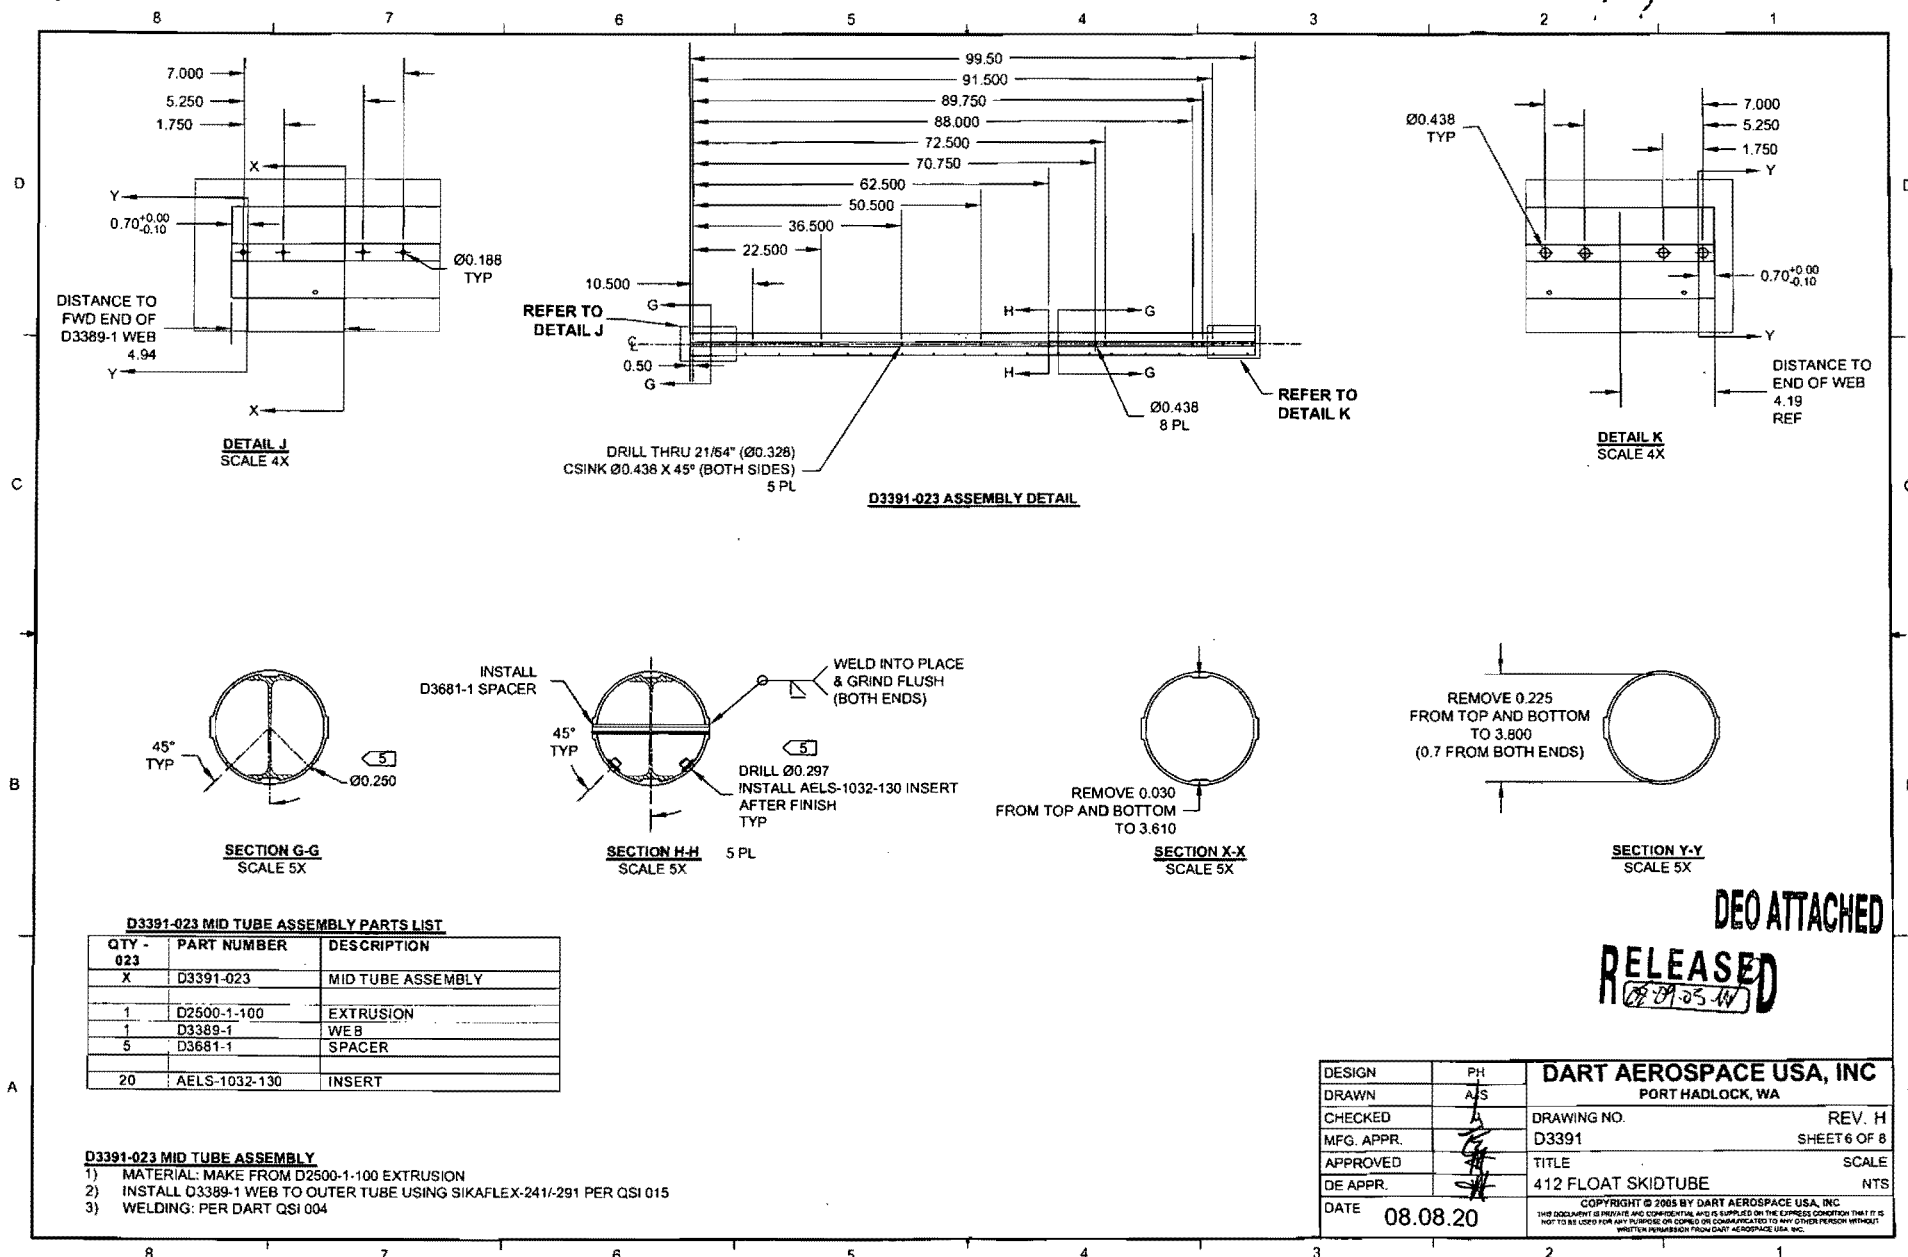

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

8 7 6 5 4 3 2 1

**VIEW BB-BB**  
SCALE 4X

1.526 REF  
0.200 REF  
R0.188

**DETAIL S**  
36.435 TO TAPER  
MACHINE CONSTANT TAPER FROM Ø3.750 TO Ø3.200  
43.3 REF  
DIST TO CENTER OF BEND  
88.93

**DETAIL V**  
SCALE 6X

0.400  
CHAMFER 30°X0.060 DEEP  
DRILL #4 (Ø0.209) 2 PL

**D3391-3 AFT DRILLING AND CUTTING DETAIL**  
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

**SECTION AA-AA**  
SCALE 6X

1.526<sup>+0.000</sup><sub>-0.030</sub>  
3.300  
Ø3.500

**SECTION N-N**  
SCALE 6X

0.200  
3.300  
Ø3.000 REF  
Ø3.750 REF

**SECTION P-P**  
SCALE 6X

0.687<sup>+0.010</sup><sub>-0.000</sub>  
3.520  
Ø3.000 REF  
Ø3.750 REF  
R0.062

**SECTION Q-Q**  
SCALE 6X

Ø3.000 REF  
Ø3.750 REF

**SECTION R-R**  
SCALE 6X

Ø3.000 REF  
Ø3.200

**DETAIL S**  
SCALE 4X

1.750  
1.750  
R0.062  
Ø0.484 16 PL  
1.750  
5.250  
7.000

**VIEW W-W**  
SCALE 4X

0.500 REF  
R0.188  
R0.094  
0.013

**DESIGN** PH  
**DRAWN** AUS  
**CHECKED** J  
**MFG. APPR.** J  
**APPROVED** J  
**DE APPR.** J  
**DATE** 08.08.20

**DART AEROSPACE USA, INC**  
PORT HADLOCK, WA

**DRAWING NO.** D3391  
**TITLE** 412 FLOAT SKIDTUBE  
**SCALE** NTS

**REV. H**  
SHEET 7 OF 8

**RELEASED**  
08-08-20

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

u668229

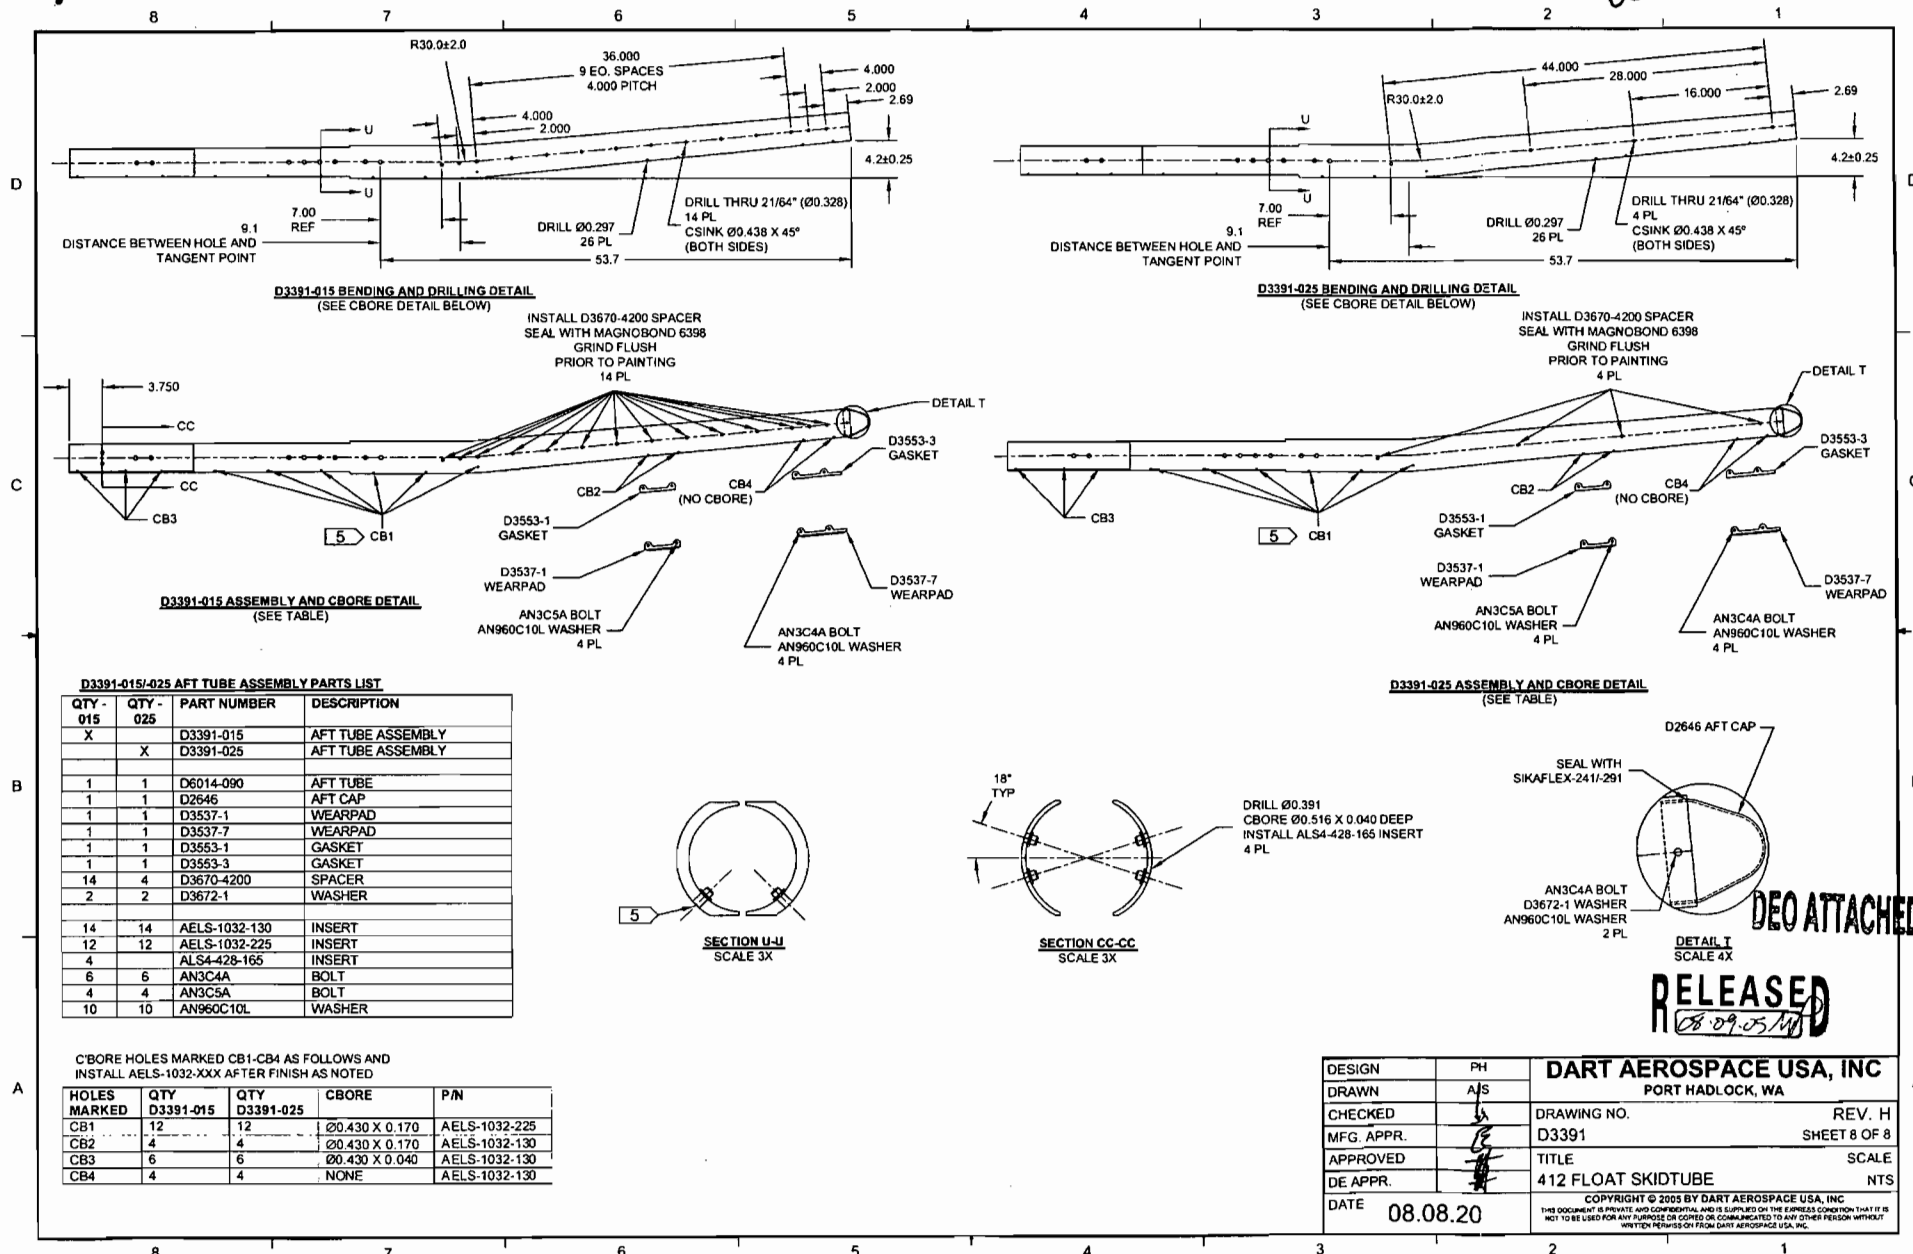


D3391-015/025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4		ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND  
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

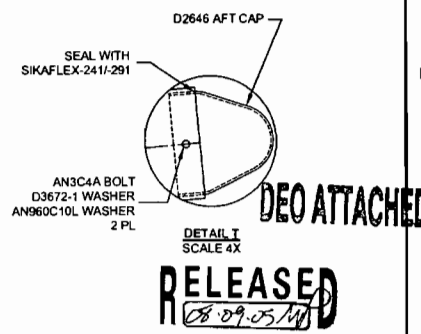

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

DRAWING NO. D3391	TITLE 412 FLOAT SKIDTUBE	REV. H	<b>DART AEROSPACE USA, INC ENGINEERING ORDER</b>		D.E.O. NO. D3391-H-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>CP</i>	CHECKED <i>h</i>	MFG. APPR. <i>M</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 09.09.23	DATE 04.04.24	DATE 09/09/25	DATE 09/09/30		DATE 09/09/30		

**PURPOSE:**

LPS-3 IS NO LONGER USED DURING ASSEMBLY OF D3391-041/-043 SKIDTUBES.

**CHANGE:**

AMEND NOTE 2 OF D3391-041/-043 SKIDTUBE ASSEMBLIES (ZN A6-1, A6-2) AS FOLLOWS:

- 2) ~~SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH~~  
~~AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH~~  
 LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS  
 OFF POWDER COATING WITH MEK DEGREASER.

**RELEASED**  
 2010-02-02

*W/b 082-29 MP*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



NO. 244

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barkley Elliott  
Job number: 65328  
Part number: A3391-023  
Description: mid tube  
Welding Process: Tig[☒] Mig[ ]  
Base material: Aluminum  
Current: AC[ ] DC[ ]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[ ]  
Penetration: pass[☒] fail[ ]

UNACCEPTABLE

Cracks: pass[☒] fail[ ]  
Undercut: pass[☒] fail[ ]  
Pin holes: pass[ ] fail[ ]  
Overlap (cold lap): pass[☒] fail[ ]  
Porosity (surface): pass[☒] fail[ ]  
Coloration: pass[☒] fail[ ]

Qualifier Lat Herring Date of Test Coupon 11-01-18  
Welder Barkley Elliott Date of Test Coupon 11-01-18

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

